



Office of the Illinois State Fire Marshal
Division of Petroleum and Chemical Safety
1035 Stevenson Drive
Springfield, IL 62703
2177851020

FOR OFFICE USE ONLY

Facility # 2042052
Permit # 01076-2019UPG
Request Rec'd 06/03/2019
Amended Date
Approval Date 6/6/2019 DS
Permit Expires 12/6/2019

Permit for UPGRADE or REPAIR of Underground Storage Tank(s) and Piping for Petroleum and Hazardous Substances.

Permission to upgrade or repair underground storage tank(s) or piping is hereby granted. Such upgrade or repair must be in complete accordance with acceptable materials as specified in the Federal Register, Part II Environmental Protection Agency, 40 CFR Parts 280 and 281, and also with all sections of 41 Illinois Administrative Code, Parts 174, 175 and 176. The contractor the permit was issued to or an employee of that contractor (this does not include a subcontractor) shall submit a required job schedule for underground piping upgrade, leak detection, spill and overfill prevention of underground storage tank(s) to the Office of the State Fire Marshal, Division of Petroleum and Chemical Safety.

(1) <u>OWNER OF TANKS</u> - Corporation, partnership, or other business entity: CIMA Developers, LP 30W180 Butterfield Rd. Warrenville, IL 60555 Contact: PETER MANCINI (630) 653-1700	(2) <u>FACILITY</u> - name and address where tanks are located: Amoco 34095 245 Randall Road South Elgin, IL 60177 Contact: Guy Morgano (847) 841-8320
--	--

(3) UPGRADE OR REPAIR OF TANKS:

(a) *Number and size of tanks being upgraded or repaired: (TK # 1) - 20,000, (TK # 2) - 15,000*

(b) *Type of tanks:*

(c) *Type of piping: (TK # 1, 2) Piping - Fiberglass Double Wall Ameron Dualoy 3000/LCX to accomodate new dispenser sumps only, (TK # 1, 2) Piping - Ball Valves, (TK # 1, 2) Piping - Shear Valves, (TK # 1, 2) Piping - Flex Connector Steel*

(d) *Product to be stored in each tank: (TK # 1) - Gasoline - Regular, (TK # 2) - Gasoline - Premium*

(e) *Type of leak detection being used:*

Tank:

Piping: (TK # 1, 2) Leak Detect - Piping - Non-Discriminating Sump Sensor Interstitial Monitoring Veeder Root in all dispenser sumps. NOTE: Sensors MUST shut down the submersible pump supplying that line upon detection of a leak per 175.640 a) 1)

(f) *Corrosion Protection being used:*

Tank:

Piping:

(g) *Spill containment devices, piping, and dispenser containmnt devices:*

(h) *Overfill prevention devices:*

(i) *Manway accessible at grade:*

(4) The owner must notify this Office when completion of tank upgrade/repair has occurred, on the Notification for Underground Storage Tank Form and the licensed contractor must submit the required job schedule for underground piping upgrade, leak detection, spill and overfill prevention to the OSFM prior to the work being performed. Both forms can be obtained at www.sfm.illinois.gov or by calling (217)785-1020.

(5) **SPECIAL CONTINGENCIES** : Removing all 10 islands, relocating the 5 west islands to outside the canopy post and installing UDC Bravo B- 1000 containment with double wall 3000/LCX piping, flex connectors, and shear valves. Rebuilding the 5 east islands in place. All islands will receive new dispensers. New dispensers will come with new intercom speakers which are faulty in existing dispensers. This is to address N.O.V. E0020191370. **NOTE: Furthest Northern dispensers are close to the minimum 10' setback distance but have been measured and deemed to meet it, per Brent Fox (contractor) as shown**

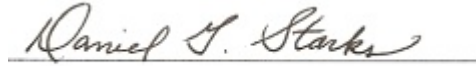
in site drawing.

(6) PERSON, FIRM OR COMPANY PERFORMING WORK:

B & K Equipment Company
2939 175th Street
Lansing, IL 60438

Contact Person: Ed Angell
Phone: (708) 474-3344
Contractor Registration # IL1207 Exp. 2/14/2020

Sincerely,

A handwritten signature in cursive script that reads "Daniel G. Starks". The signature is written in dark ink and is positioned above a horizontal line.

Daniel Starks

cc: Storage Tank Safety Specialist
Division File