



Office of the Illinois State Fire Marshal
Division of Petroleum and Chemical Safety
1035 Stevenson Drive
Springfield, IL 62703
2177851020

FOR OFFICE USE ONLY

Facility # 2017173
Permit # 01984-2019UPG
Request Rec'd 10/16/2019
Amended Date
Approval Date 10/16/2019 DS
Permit Expires 4/16/2020

Permit for UPGRADE or REPAIR of Underground Storage Tank(s) and Piping for Petroleum and Hazardous Substances.

Permission to upgrade or repair underground storage tank(s) or piping is hereby granted. Such upgrade or repair must be in complete accordance with acceptable materials as specified in the Federal Register, Part II Environmental Protection Agency, 40 CFR Parts 280 and 281, and also with all sections of 41 Illinois Administrative Code, Parts 174, 175 and 176. The contractor the permit was issued to or an employee of that contractor (this does not include a subcontractor) shall submit a required job schedule for underground piping upgrade, leak detection, spill and overfill prevention of underground storage tank(s) to the Office of the State Fire Marshal, Division of Petroleum and Chemical Safety.

(1) OWNER OF TANKS - Corporation, partnership, or other business entity: Viti Charitable Trust / Harris Bank 445 Sheridan Road Highwood, IL 60040 Contact: Gabriel Viti (847) 432-1000	(2) FACILITY - name and address where tanks are located: Deerfield BP 1460 Waukegan Road Deerfield, IL 60015 Contact: Dan Welch (847) 675-0005
---	---

(3) UPGRADE OR REPAIR OF TANKS:

- (a) *Number and size of tanks being upgraded or repaired: (TK # 6) - 12,000, (TK # 7) - 8,000*
- (b) *Type of tanks:*
- (c) *Type of piping: (TK # 6, 7) Piping - Other submersible pump, (TK # 6, 7) Piping - Ball Valves, (TK # 6, 7) Piping - Flex Connector Steel, (TK # 6, 7) Piping - Single Wall STP/Tanktop Sump Unknown Fiberglass*
- (d) *Product to be stored in each tank: (TK # 6) - Gasoline - Regular, (TK # 7) - Gasoline - Premium*
- (e) *Type of leak detection being used:*
 - Tank:*
 - Piping: (TK # 6, 7) Leak Detect - Piping - Electronic Pressurized Line Leak Detection Veeder Root TLS 350 PLLD leak sensors*
- (f) *Corrosion Protection being used:*
 - Tank:*
 - Piping:*
- (g) *Spill containment devices, piping, and dispenser containment devices:*
- (h) *Overfill prevention devices:*
- (i) *Manway accessible at grade:*

- (4) The owner must notify this Office when completion of tank upgrade/repair has occurred, on the Notification for Underground Storage Tank Form and the licensed contractor must submit the required job schedule for underground piping upgrade, leak detection, spill and overfill prevention to the OSFM prior to the work being performed. Both forms can be obtained at www.sfm.illinois.gov or by calling (217)785-1020.

(5) SPECIAL CONTINGENCIES :

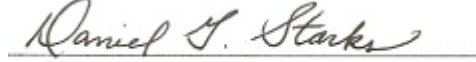
Remove existing (2) Poly submerge pump sumps, submerge pumping units
Have Xerxes tank attached tank collars onto tanks for new sumps
Install (2) new Bravo B-421-48-S-50 Single wall fiberglass sumps with Brave FRP entry fittings
Re install existing Flexible product piping back into sumps
Install new FE Petro STP150VL2 1-1/2 submerge pumps
Add to existing Veeder Root TLS-350 PLLD electronic line leak detection with upgraded software and Risk Management software. Reinstall existing sump sensors.

(6) PERSON, FIRM OR COMPANY PERFORMING WORK:

Stenstrom Petroleum Services Group
2422 Center Street
Rockford, IL 61108

Contact Person: Robert Stenstrom
Phone: (815) 398-6250
Contractor Registration # IL1890 Exp. 4/12/2020

Sincerely,

A handwritten signature in cursive script, reading "Daniel H. Starks", is written over a horizontal line.

Daniel Starks

cc: Storage Tank Safety Specialist
Division File