



Office of the Illinois State Fire Marshal  
Division of Petroleum and Chemical Safety  
1035 Stevenson Drive  
Springfield, IL 62703  
2177851020

**Amended**

**FOR OFFICE USE ONLY**

Facility # 4036824  
Permit # 00205-2018INS  
Request Rec'd 02/07/2018  
Amended Date 08/06/2018 DS  
Approval Date 2/21/2018 DS  
Permit Expires 8/21/2018

**Permit for INSTALLATION of Underground Storage Tank(s) and Piping for Petroleum and Hazardous Substances.**

Permission to install underground storage tank(s) or piping is hereby granted. Such installation must be in complete accordance with acceptable materials as specified in the Federal Register, Part II Environmental Protection Agency, 40 CFR Parts 280 and 281, and also with all sections of 41 Illinois Administrative Code, Parts 174, 175 and 176. The contractor the permit was issued to or an employee of that contractor (this does not include a subcontractor) shall submit a required job schedule for installation of underground storage tank(s) to the Office of the State Fire Marshal, Division of Petroleum and Chemical Safety. **THIS PERMIT IS VALID FOR SIX MONTHS FROM THE APPROVAL DATE.**

<p><b>(1) <u>OWNER OF TANKS</u></b> - Corporation, partnership, or other business entity:</p> <p>Casey's Retail Company P.O. Box 3001 3305 SE Delaware Ave. Ankeny, IA 50021</p> <p>Contact: Jill Reams-Widder (515) 965-6238</p>	<p><b>(2) <u>FACILITY</u></b> - name and address where tanks are located:</p> <p>Casey's General Store #2066 1501 N. Michigan Ave. Marshall, IL 62441</p> <p>Contact: Jill Reams-Widder (515) 965-6238</p>
---	--

**(3) INSTALLATION OF TANKS:**

- (a) Number and size of tanks being installed: (TK # 3) - 22,000, (TK # 4) - 14,000, (TK # 5, 6, 7) - 8,000*
- (b) Type of tank(s): (TK # 3, 4, 5, 6, 7) Tank - Fiberglass Double Wall XERXES*
- (c) Type of piping: (TK # 3, 4, 5, 6, 7) Piping - Flexible Double Wall A.P.T. Poly Tech P175SC, (TK # 3, 4, 5, 6, 7) Piping - Shear Valves, (TK # 3, 4, 5, 6, 7) Piping - Submersible Sumps Franklin Fueling Systems A4836-0/0-OB-S Single Wall*
- (d) Product to be stored in each tank: (TK # 3, 5, 6, 7) - Gasoline, (TK # 4) - Diesel Fuel*
- (e) Type of leak detection being used:*
  - Tank: (TK # 3, 4, 5, 6, 7) Leak Detect - Tank - Interstitial Monitoring Veeder Root TLS 450 Plus*
  - Piping: (TK # 3, 4, 5, 6, 7) Leak Detect - Piping - Piping Sump Sensors Interstitial Monitoring Veeder Root TLS 450 Plus*
- (f) Corrosion Protection being used:*
  - Tank: (TK # 3, 4, 5, 6, 7) Corrosion Prot - Tank - Fiberglass Non-Corrosive*
  - Piping: (TK # 3, 4, 5, 6, 7) Corrosion Prot - Piping - Flexible Non-Corrosive*
- (g) Spill containment devices, piping and dispenser containment devices: (TK # 3, 4, 5, 6, 7) Spill Contain Device - Manhole Pre-manufactured EBW 705 Single Wall*
- (h) Overfill prevention devices: (TK # 3, 4, 5, 6, 7) Overfill Prev Device - Overfill Drop Tube Valve OPW 71SO*

- (4)** The owner must notify this Office when completion of tank installation has occurred, on the Notification for Underground Storage Tank Form and the licensed contractor must submit the required job schedule for installation to the OSFM prior to the work being performed. Both forms can be obtained at [www.sfm.illinois.gov](http://www.sfm.illinois.gov) by calling (217)785-1020.

- (5) GENERAL REQUIREMENTS** : There shall be a minimum of two manufactured slotted or perforated observation wells of at least 4 inches in diameter, installed in each new tank field of tanks larger than 1000 gallons and one well for tanks less than 1000 gallons. A water tight containment shall be installed under all dispensers and at submersible pumps. A hydrostatic test must be performed on all containments. All steel piping for vents, risers, and fills in contact with the ground, backfill, or water shall be dielectrically wrapped or coated. A positive shut off valve shall be installed on pressurized product lines, at the submersibles, or installed at the tank for all suction piping systems. Vent piping is required to be tested from tank to grade level. All steel flex connectors in contact with ground, backfill or water shall have corrosion protection.

- (6) SPECIAL CONTINGENCIES** :

We need to revise the equipment that is being installed the tank monitor will be a V/R TLS 450 Plus not a 350 as permitted. The sump sensors will be V/R discriminating sensors not the V/R 794380-208 as permitted.

Owner has decided to go back to the originally permitted standard sump sensors. Veederroot 794380-208.

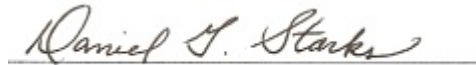
this is due to the testing protocol for discriminating sensors.

**(6) PERSON, FIRM OR COMPANY PERFORMING WORK:**

Illinois Oil Marketing Equipment, Inc.  
850 Brenkman Drive  
Pekin, IL 61554

Contact Person: Chris Epkins  
Phone: (309) 347-1819  
Contractor Registration # IL1293 Exp. 2/4/2020

Sincerely,

A handwritten signature in cursive script, reading "Daniel G. Starks", is written over a horizontal line.

Daniel Starks

cc: Storage Tank Safety Specialist  
Division File