



Office of the Illinois State Fire Marshal
Division of Petroleum and Chemical Safety
1035 Stevenson Drive
Springfield, IL 62703
2177851020

FOR OFFICE USE ONLY

Facility # 4017906
Permit # 00401-2022INS
Request Rec'd 04/12/2022
Amended Date
Approval Date 4/17/2022 DS
Permit Expires 10/18/2022

Permit for INSTALLATION of Underground Storage Tank(s) and Piping for Petroleum and Hazardous Substances.

Permission to install underground storage tank(s) or piping is hereby granted. Such installation must be in complete accordance with acceptable materials as specified in the Federal Register, Part II Environmental Protection Agency, 40 CFR Parts 280 and 281, and also with all sections of 41 Illinois Administrative Code, Parts 174, 175 and 176. The contractor the permit was issued to or an employee of that contractor (this does not include a subcontractor) shall submit a required job schedule for installation of underground storage tank(s) to the Office of the State Fire Marshal, Division of Petroleum and Chemical Safety. **THIS PERMIT IS VALID FOR SIX MONTHS FROM THE APPROVAL DATE.**

(1) OWNER OF TANKS - Corporation, partnership, or other business entity: Grant & Grant Investment LTD 101 West Division Street Findlay, IL 62534 Contact: Christina Grant (217) 756-3143	(2) FACILITY - name and address where tanks are located: R & K One Stop, Inc. 101 West Division Findlay, IL 62534 Contact: Christina Grant (217) 756-3154
---	--

(3) INSTALLATION OF TANKS:

- (a) Number and size of tanks being installed: (TK # 7) - 9,000, (TK # 8) - 3,000*
- (b) Type of tank(s): (TK # 7, 8) Tank - Composite Double Wall Glasteel II*
- (c) Type of piping: (TK # 7, 8) Piping - Flexible Double Wall OPW Flexworks , (TK # 7, 8) Piping - Shear Valves , (TK # 7, 8) Piping - Flex Connector Steel, (TK # 7, 8) Piping - Single Wall STP/Tanktop Sump*
- (d) Product to be stored in each tank: (TK # 7) - Gasoline - Regular, (TK # 8) - Gasoline - Premium*
- (e) Type of leak detection being used:*
 - Tank: (TK # 7, 8) Leak Detect - Tank - Automatic Tank Gauging Veeder Root TLS 300 , (TK # 7, 8) Leak Detect - Tank - Non-Discriminating Interstitial Monitoring Sensors*
 - Piping: (TK # 7, 8) Leak Detect - Piping - Mechanical Pressurized Line Leak Detection, (TK # 7, 8) Leak Detect - Piping - Non-Discriminating Sump Sensor with positive shutdown, (TK # 7, 8) Leak Detect - Piping - Stand Alone Sump Sensor Discriminating*
- (f) Corrosion Protection being used:*
 - Tank: (TK # 7, 8) Corrosion Prot - Tank - Jacketed Steel Non-Corrosive*
 - Piping: (TK # 7, 8) Corrosion Prot - Piping - Flexible Non-Corrosive*
- (g) Spill containment devices, piping and dispenser containment devices: (TK # 7, 8) Spill Contain Device - Double Wall Spill Bucket*
- (h) Overfill prevention devices: (TK # 7, 8) Overfill Prev Device - Overfill Drop Tube Valve*

- (4)** The owner must notify this Office when completion of tank installation has occurred, on the Notification for Underground Storage Tank Form and the licensed contractor must submit the required job schedule for installation to the OSFM prior to the work being performed. Both forms can be obtained at www.sfm.illinois.gov or by calling (217)785-1020.
- (5) GENERAL REQUIREMENTS** : There shall be a minimum of two manufactured slotted or perforated observation wells of at least 4 inches in diameter, installed in each new tank field of tanks larger than 1000 gallons and one well for tanks less than 1000 gallons. A water tight containment shall be installed under all dispensers and at submersible pumps. A hydrostatic test must be performed on all containments. All steel piping for vents, risers, and fills in contact with the ground, backfill, or water shall be dielectrically wrapped or coated. A positive shut off valve shall be installed on pressurized product lines, at the submersibles, or installed at the tank for all suction piping systems. Vent piping is required to be tested from tank to grade level. All steel flex connectors in contact with ground, backfill or water shall have corrosion protection.
- (6) SPECIAL CONTINGENCIES** : Installation of a 12,000 gallon Glasteel II Tank, (Split Compartment 3,000 gallon, 9,000 gallon), with manways, sumps, risers, straps, by manufacturer, installed with deadmen and turnbuckles. STP 3/4 HP 410140-002 pumps, schedule 40 black risers, FX1V 116-056-5 mechanical leak detectors, 5-gallon 1C-3112P DW Edge overspill containers, 4" 71SO-410C overfill prevention


valves, we will use the existing VR TLS-300, with non-discriminating 794380-208 sump sensors, non-discrimination 794390-409 interstitial sensors, 8' 846396-107 0.1 GPH Mag Plus probes, with 4" 886100-000 float kits. 1 1/2" 10BFP-5726 Double Poppet Emergency Shut-Off shear valves, 2" x 24" FSFS240200-ZC Fireshield Stainless steel flex connectors, 30" YJVSLEEVEII Yellow Jacket boots, 1-1/2" C15A-250 FLexWorks DW piping, 4" secondary all bolt and swivel fittings to complete, Polyethylene DS-1642 dispenser sumps, with SBK-1600 stabilizer brackets, all bulhead and entry fittings for tank and dispenser sumps. @' 22884386 Dualoy 3000/L SW FRP vent piping with 2" 23-0033 updraft vent caps.

(6) PERSON, FIRM OR COMPANY PERFORMING WORK:

Bolin Enterprises, Inc.
506 North East 15th Street PO Box 70
Casey, IL 62420

Contact Person: Scott Justice
Phone: (217) 932-4533
Contractor Registration # IL002333 Exp. 10/10/2022

Sincerely,

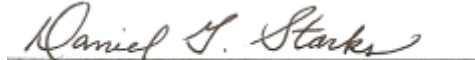

Daniel Starks

cc: Storage Tank Safety Specialist
Division File